

P-NITROANILINE

Version No:3
Page 1 of 11

GHS SAFETY DATA SHEET

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME

P-NITROANILINE

OTHER NAMES

C6-H6-N2-O2, p-aminonitrobenzene, 1-amino-4-nitrobenzene, "aniline, 4-nitro-", "C.I. 37035", p-nitraniline, 4-nitraniline, 4-nitrobenzenamine, p-nitrophenylamine

PROPER SHIPPING NAME

NITROANILINES (o-, m-, p-)

PRODUCT USE

Manufacture of dyes, intermediate for antioxidants, gum inhibitors, corrosion inhibitors.

SUPPLIER

Company: S D FINE- CHEM LIMITED

Address:

315- 317, T.V. INDUSTRIAL ESTATE,
248, WORLI,
MUMBAI- 400030.INDIA.


technical@sdfine.com

Telephone: 91- 22- 24959898

Telephone: 91- 22- 24959899

Fax: 91- 22- 24937232

HAZARD RATINGS

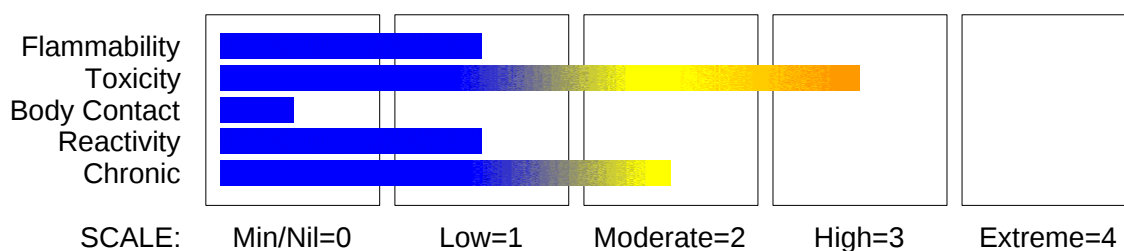

Section 2 - HAZARDS IDENTIFICATION

GHS Classification

Acute Toxicity (Dermal) Category 3

continued...

P-NITROANILINE

Acute Toxicity (Inhalation) Category 3
Acute Toxicity (Oral) Category 3
Chronic Aquatic Hazard Category 3
Organ Damage Category 2



EMERGENCY OVERVIEW

HAZARD

DANGER

Determined by using GHS criteria:

H331 H311 H301 H373 H412

Toxic if inhaled

Toxic in contact with skin

Toxic if swallowed

May cause damage to organs through prolonged or repeated exposure.

Harmful to aquatic life with long lasting effects

PRECAUTIONARY STATEMENTS

Prevention

Do not breathe dust/fume/gas/mist/vapours/spray.

Wear protective gloves/clothing

Avoid breathing dust/fume/gas/mist/vapours/spray.

Use only outdoors or in a well ventilated area.

Do not eat, drink or smoke when using this product.

Wash hands thoroughly after handling.

Response

Get medical advice/attention if you feel unwell.

Immediately call a POISON CENTER or doctor/physician.

IF ON SKIN: Gently wash with plenty of soap and water.

IF INHALED: Remove to fresh air and keep at rest in a position comfortable for breathing.

Keep container tightly closed.

Call a POISON CENTER or doctor/physician if you feel unwell.

IF SWALLOWED: Immediately call a POISON CENTER or doctor/physician.

Specific treatment: refer to Label or MSDS.

Wash/Decontaminate removed clothing before reuse.

Remove/Take off immediately all contaminated clothing

Storage

Store locked up.

Disposal

Dispose of contents and container in accordance with relevant legislation.

P-NITROANILINE

Page 3 of 11

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
p- nitroaniline	100-01-6	>98

Section 4 - FIRST AID MEASURES

SWALLOWED

For advice, contact a Poisons Information Centre or a doctor.

- IF SWALLOWED, REFER FOR MEDICAL ATTENTION, WHERE POSSIBLE, WITHOUT DELAY.

- For advice, contact a Poisons Information Centre or a doctor.

Where Medical attention is not immediately available or where the patient is more than 15 minutes from a hospital or unless instructed otherwise:

- Induce vomiting with fingers down the back of the of the throat, ONLY IF CONSCIOUS.

- Lean patient forward or place on left side (head-down position if possible) to maintain open airway and prevent aspiration.

NOTE: Wear a protective glove when inducing vomiting by mechanical means.

- In the mean time, qualified first-aid personnel should treat the patient following observation and employing supportive measures as indicated by the patient's condition.

- If the services of a medical officer or medical doctor are readily available, the patient should be placed in his/her care and a copy of the MSDS should be provided.

Further action will be the responsibility of the medical specialist.

- If medical attention is not available on the worksite or surroundings send the patient to a hospital together with a copy of the MSDS.

EYE

If this product comes in contact with the eyes:

- Immediately hold eyelids apart and flush the eye continuously with running water.

- Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.

- Continue flushing until advised to stop by the Poisons Information Centre or a doctor, or for at least 15 minutes.

- Transport to hospital or doctor without delay.

- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

If skin or hair contact occurs:

- Quickly but gently, wipe material off skin with a dry, clean cloth.

- Immediately remove all contaminated clothing, including footwear.

- Wash skin and hair with running water. Continue flushing with water until advised to stop by the Poisons Information Centre.

- Transport to hospital, or doctor.

INHALED

- If dust is inhaled, remove from contaminated area.

- Encourage patient to blow nose to ensure clear passage of breathing.

- If irritation or discomfort persists seek medical attention.

NOTES TO PHYSICIAN

The material may induce methaemoglobinaemia following exposure.

- Initial attention should be directed at oxygen delivery and assisted ventilation if necessary. Hyperbaric oxygen has not demonstrated substantial benefits.

- Hypotension should respond to Trendelenburg's position and intravenous fluids; otherwise dopamine may be needed.

- Symptomatic patients with methaemoglobin levels over 30% should receive methylene blue.

continued...

P-NITROANILINE

(Cyanosis, alone, is not an indication for treatment). The usual dose is 1-2 mg/kg of a 1% solution (10 mg/ml) IV over 50 minutes; repeat, using the same dose, if symptoms of hypoxia fail to subside within 1 hour.

· Thorough cleansing of the entire contaminated area of the body, including the scalp and nails, is of utmost importance.

BIOLOGICAL EXPOSURE INDEX - BEI

These represent the determinants observed in specimens collected from a healthy worker exposed at the Exposure Standard (ES or TLV):

Determinant	Index	Sampling Time	Comment
1. Methaemoglobin in blood	1.5% of haemoglobin	During or end of shift	B, NS, SQ

B: Background levels occur in specimens collected from subjects NOT exposed

NS: Non-specific determinant; also observed after exposure to other materials

SQ: Semi-quantitative determinant - Interpretation may be ambiguous; should be used as a screening test or confirmatory test.

Section 5 - FIRE FIGHTING MEASURES

EXTINGUISHING MEDIA

- Foam.
- Dry chemical powder.
- BCF (where regulations permit).
- Carbon dioxide.
- Water spray or fog - Large fires only.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
 - Wear full body protective clothing with breathing apparatus.
 - Prevent, by any means available, spillage from entering drains or water course.
 - Use water delivered as a fine spray to control fire and cool adjacent area.
 - Avoid spraying water onto liquid pools.
 - DO NOT approach containers suspected to be hot.
 - Cool fire exposed containers with water spray from a protected location.
 - If safe to do so, remove containers from path of fire.
- Equipment should be thoroughly decontaminated after use.

FIRE/EXPLOSION HAZARD

- Solid which exhibits difficult combustion or is difficult to ignite.
- Avoid generating dust, particularly clouds of dust in a confined or unventilated space as dusts may form an explosive mixture with air, and any source of ignition, i.e. flame or spark, will cause fire or explosion. Dust clouds generated by the fine grinding of the solid are a particular hazard; accumulations of fine dust may burn rapidly and fiercely if ignited.
- Dry dust can also be charged electrostatically by turbulence, pneumatic transport, pouring, in exhaust ducts and during transport.
- Build-up of electrostatic charge may be prevented by bonding and grounding.
- Powder handling equipment such as dust collectors, dryers and mills may require additional protection measures such as explosion venting.
- All movable parts coming in contact with this material should have a speed of less than 1-metre/sec.

Combustion products include:.

carbon dioxide (CO₂) and nitrogen oxides (NO_x).

P-NITROANILINE

FIRE INCOMPATIBILITY

Avoid contamination with oxidising agents i.e. nitrates, oxidising acids, chlorine bleaches, pool chlorine etc. as ignition may result.

Personal Protective Equipment

Breathing apparatus.
Gas tight chemical resistant suit.
Limit exposure duration to 1 BA set 30 mins.

Section 6 - ACCIDENTAL RELEASE MEASURES

EMERGENCY PROCEDURES

MINOR SPILLS

Environmental hazard - contain spillage.
Clean up all spills immediately.
Wear protective clothing, impervious gloves and safety glasses.
Avoid breathing vapours and contact with skin and eyes.
Remove all ignition sources.
Use dry clean up procedures and avoid generating dust.
Place in suitable containers for disposal.

MAJOR SPILLS

Pollutant

- Clear area of personnel and move upwind.
- Alert Fire Brigade and tell them location and nature of hazard.
- Wear full body protective clothing with breathing apparatus.
- Prevent, by any means available, spillage from entering drains or water courses.
- No smoking, naked lights or ignition sources.
- Increase ventilation.
- Stop leak if safe to do so.
- Water spray or fog may be used to disperse / absorb vapour.
- Contain or absorb spill with sand, earth or vermiculite.
- Collect recoverable product into labelled containers for recycling.
- Collect solid residues and seal in labelled drums for disposal.
- Wash area and prevent runoff into drains.
- After clean up operations, decontaminate and launder all protective clothing and equipment before storing and re-using.
- If contamination of drains or waterways occurs, advise emergency services.

EMERGENCY RESPONSE PLANNING GUIDELINES (ERPG)

The maximum airborne concentration below which it is believed that nearly all individuals could be exposed for up to one hour WITHOUT experiencing or developing

life-threatening health effects is:

p-nitroaniline 300 mg/m³

irreversible or other serious effects or symptoms which could impair an individual's ability to take protective action is:

p-nitroaniline 150 mg/m³

other than mild, transient adverse effects without perceiving a clearly defined odour is:

p-nitroaniline 9 mg/m³

The threshold concentration below which most people will experience no appreciable risk of health effects:

p-nitroaniline 6 mg/m³

continued...

P-NITROANILINE

American Industrial Hygiene Association (AIHA)

Ingredients considered according to the following cutoffs

Very Toxic (T+)	$\geq 0.1\%$	Toxic (T)	$\geq 3.0\%$
R50	$\geq 0.25\%$	Corrosive (C)	$\geq 5.0\%$
R51	$\geq 2.5\%$		
else	$\geq 10\%$		

where percentage is percentage of ingredient found in the mixture

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS



X X + X X +

+: May be stored together

O: May be stored together with specific preventions

X: Must not be stored together

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

Section 7 - HANDLING AND STORAGE

PROCEDURE FOR HANDLING

- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.
- Avoid smoking, naked lights or ignition sources.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately.
- Use good occupational work practice.
- Observe manufacturer's storing and handling recommendations.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions.

SUITABLE CONTAINER

- Metal can or drum
- Packaging as recommended by manufacturer.
- Check all containers are clearly labelled and free from leaks.

STORAGE INCOMPATIBILITY

- Avoid reaction with oxidising agents.
- Avoid reaction with strong acids and reducing agents.

STORAGE REQUIREMENTS

- Store in original containers.
- Keep containers securely sealed.
- No smoking, naked lights or ignition sources.

P-NITROANILINE

- Store in a cool, dry, well-ventilated area.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations.

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

EXPOSURE CONTROLS

The following materials had no OELs on our records

- p- nitroaniline: CAS:100- 01- 6

EMERGENCY EXPOSURE LIMITS

Material	Revised IDLH Value (mg/m ³)	Revised IDLH Value (ppm)
p- nitroaniline	300 [Unch]	

MATERIAL DATA

Para-nitroaniline produces functional anaemia with peripheral tissue anoxia due to the formation of methaemoglobinaemia. Chronic exposures reportedly produce jaundice (liver damage) and anaemia. The TLV-TWA is thought to be protective against these effects. This material is a more potent cyanogen and anaemiogen than aniline and the TLV reflects this. Exposure to particulates or mists are particularly hazardous. Percutaneous absorption of toxic amounts has also been demonstrated.

PERSONAL PROTECTION



EYE

- Chemical goggles.
- Full face shield may be required for supplementary but never for primary protection of eyes
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59].

HANDS/FEET

Wear chemical protective gloves, eg. PVC.
Wear safety footwear. PVC gumboots may be required.

P-NITROANILINE

OTHER

- Overalls.
- PVC Apron.
- PVC protective suit may be required if exposure severe.
- Eyewash unit.
- Ensure there is ready access to a safety shower.

RESPIRATOR

Protection Factor	Half- Face Respirator	Full- Face Respirator	Powered Air Respirator
10 x ES	AK P1 Air- line*	- -	AK PAPR- P1 -
50 x ES	Air- line**	AK P2	AK PAPR- P2
100 x ES	-	AK P3	-
		Air- line*	-
100+ x ES	-	Air- line**	AK PAPR- P3

* - Negative pressure demand ** - Continuous flow.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required.

For further information consult your Occupational Health and Safety Advisor.

ENGINEERING CONTROLS

General exhaust is adequate under normal operating conditions. Local exhaust ventilation may be required in specific circumstances. If risk of overexposure exists, wear approved respirator. Correct fit is essential to obtain adequate protection. Provide adequate ventilation in warehouse or closed storage areas. Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

Type of Contaminant:	Air Speed:
solvent, vapours, degreasing etc., evaporating from tank (in still air).	0.25- 0.5 m/s (50- 100 f/min)
aerosols, fumes from pouring operations, intermittent container filling, low speed conveyer transfers, welding, spray drift, plating acid fumes, pickling (released at low velocity into zone of active generation)	0.5- 1 m/s (100- 200 f/min.)
direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion)	1- 2.5 m/s (200- 500 f/min.)
grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion).	2.5- 10 m/s (500- 2000 f/min.)

Within each range the appropriate value depends on:

Lower end of the range	Upper end of the range
1: Room air currents minimal or favourable to capture	1: Disturbing room air currents
2: Contaminants of low toxicity or of nuisance value only.	2: Contaminants of high toxicity
3: Intermittent, low production.	3: High production, heavy use
4: Large hood or large air mass in motion	4: Small hood- local control only

Simple theory shows that air velocity falls rapidly with distance away from the opening

continued...

P-NITROANILINE

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 1-2 m/s (200-400 f/min) for extraction of solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

APPEARANCE

Yellow crystal, insoluble in water. Faint pungent ammonia odour.
Practically insoluble in water (0.08 %).

PHYSICAL PROPERTIES

Solid.

Does not mix with water.

Sinks in water.

Molecular Weight: 138.14

Melting Range (°C): 146- 148

Solubility in water (g/L): Immiscible

pH (1% solution): Not applicable

Volatile Component (%vol): Not available

Relative Vapour Density (air=1): Not available

Lower Explosive Limit (%): Not available.

Autoignition Temp (°C): Not available.

State: Divided solid

Boiling Range (°C): 336 (decomp.)

Specific Gravity (water=1): 1.42

pH (as supplied): Not applicable

Vapour Pressure (kPa): 0.1 @ 142 deg.

Evaporation Rate: Not available

Flash Point (°C): 165 (C.O.C)

Upper Explosive Limit (%): Not available.

Decomposition Temp (°C): Not available

Viscosity: Not available

Section 10 - CHEMICAL STABILITY AND REACTIVITY INFORMATION

CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

Section 11 - TOXICOLOGICAL INFORMATION

POTENTIAL HEALTH EFFECTS

ACUTE HEALTH EFFECTS

SWALLOWED

Toxic effects may result from the accidental ingestion of the material; animal experiments indicate that ingestion of less than 40 gram may be fatal or may produce serious damage to the health of the individual.

EYE

Although the material is not thought to be an irritant (as classified by EC Directives), direct contact with the eye may produce transient discomfort characterised by tearing or conjunctival redness (as with windburn).

continued...

P-NITROANILINE

SKIN

Skin contact with the material may produce toxic effects; systemic effects may result following absorption.

The material is not thought to be a skin irritant (i.e. is unlikely to produce irritant dermatitis as described in EC Directives using animal models). Temporary discomfort, however, may result from prolonged dermal exposures. Good hygiene practice requires that exposure be kept to a minimum and that suitable gloves be used in an occupational setting.

INHALED

The material is not thought to produce respiratory irritation (as classified by EC Directives using animal models). Nevertheless inhalation, of the material, especially for prolonged periods, may produce respiratory discomfort and occasionally, distress. Persons with impaired respiratory function, airway diseases and conditions such as emphysema or chronic bronchitis, may incur further disability if excessive concentrations of particulate are inhaled.

CHRONIC HEALTH EFFECTS

Principal routes of exposure are by accidental skin and eye contact and inhalation of generated dusts.

Prolonged exposure may produce liver damage in workers.

Male mice administered p-nitroaniline by intubation (30 or 100 mg/kg/day), showed an increased incidence of hemangiosarcoma or hemangioma at all sites tested. This finding was not duplicated in female mice.

TOXICITY AND IRRITATION

TOXICITY

Oral (rat) LD50: 1400 mg/kg

Oral (rat) LD50: 750 mg/kg

IRRITATION

Eye (rabbit): FHSA 1.3/110*

Skin (rabbit): FHSA 0.0/8.0*

* [Manufacture]

The material is under review by the US NTP; GENETOX and TSCA Programs.

Section 12 - ECOLOGICAL INFORMATION

Algae IC50 (72hr.) (mg/l): 0.35- 11

Bioaccumulation: not sig

Degradation Biological: soil microflora >64 days, not sig

Ecological data: slightly toxic to fish (LC50:45 ppm/96h, Rainbow trout)

Biodegradability classed as readily to intermediate [Monsanto].

Section 13 - DISPOSAL CONSIDERATIONS

- Consult manufacturer for recycling options and recycle where possible .
- Consult State Land Waste Management Authority for disposal.
- Incinerate residue at an approved site.
- Recycle containers if possible, or dispose of in an authorised landfill.

Section 14 - TRANSPORTATION INFORMATION

P-NITROANILINE



Labels Required: TOXIC
HAZCHEM: 2X

UNDG:

Dangerous Goods Class:	6.1	Subrisk:	None
UN Number:	1661	Packing Group:	II
Shipping Name: NITROANILINES (o-, m-, p-)			

Air Transport IATA:

ICAO/IATA Class:	6.1	ICAO/IATA Subrisk:	None
UN/ID Number:	1661	Packing Group:	II
ERG Code:	6L		
Shipping name: NITROANILINES (o-, m-, p-)			

Maritime Transport IMDG:

IMDG Class:	6.1	IMDG Subrisk:	None
UN Number:	1661	Packing Group:	II
EMS Number:	F- A, S- A		
Shipping name: NITROANILINES (o-, m-, p-)			

Section 15 - REGULATORY INFORMATION

REGULATIONS

p-nitroaniline (CAS: 100-01-6) is found on the following regulatory lists;
International Council of Chemical Associations (ICCA) - High Production Volume List
OECD Representative List of High Production Volume (HPV) Chemicals

Section 16 - OTHER INFORMATION

The above information is believed to be accurate and represent the best information currently available to us, but does not represent any warranty expressed or implied of the properties of the product. User should make their own investigation to determine the suitability of the information for their particular purpose.

Issue Date: 28-Jun-2018