

## O-CRESOLPHTHALEIN COMPLEXONE

GHS Safety Data Sheet

Version No:2.0

Page 1 of 8

### Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

#### PRODUCT NAME

O-CRESOLPHTHALEIN COMPLEXONE

#### OTHER NAMES

C32-H32-N2-O12, "phthalein purple", "o-cresolphthalien-3'-3'''-bis methylene imino diacetic acid", "Metal phthalein", "Xylenylphthalein-bis iminodiacetic acid", "o-cresolphthaleindi(methylaminodiacetic acid)",

#### PRODUCT USE

Laboratory reagent, metal indicator (pM) for metal ion concentration.

#### SUPPLIER

Company: S D FINE- CHEM LIMITED

Address:

315- 317, T.V. INDUSTRIAL ESTATE,

248, WORLI,

MUMBAI- 400030.INDIA.


technical@sdfine.com

Telephone: 91- 22- 24959898

Telephone: 91- 22- 24959899

Fax: 91- 22- 24937232

#### HAZARD RATINGS

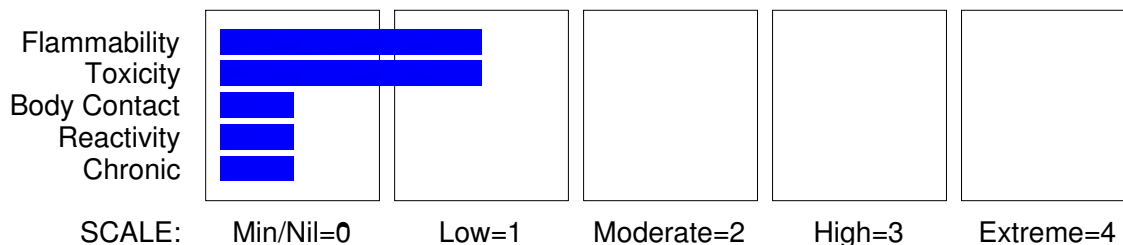

### Section 2 - HAZARDS IDENTIFICATION

#### EMERGENCY OVERVIEW

continued...

# O-CRESOLPHTHALEIN COMPLEXONE

GHS Safety Data Sheet

Version No:2.0

Page 2 of 8

## Section 2 - HAZARDS IDENTIFICATION

### HAZARD

- Not hazardous
- No hazards determined by using GHS criteria

### PRECAUTIONARY STATEMENTS

## Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

| NAME                          | CAS RN    | %   |
|-------------------------------|-----------|-----|
| o- cresolphthalein complexone | 2411-89-4 | >90 |

## Section 4 - FIRST AID MEASURES

### SWALLOWED

- Immediately give a glass of water.
- First aid is not generally required. If in doubt, contact a Poisons Information Centre or a doctor.

### EYE

- If this product comes in contact with the eyes:
- Wash out immediately with fresh running water.
  - Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
  - If pain persists or recurs seek medical attention.
  - Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

### SKIN

- If skin or hair contact occurs:
- Flush skin and hair with running water (and soap if available).
  - Seek medical attention in event of irritation.

### INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Other measures are usually unnecessary.

### NOTES TO PHYSICIAN

Treat symptomatically.

## Section 5 - FIRE FIGHTING MEASURES

### EXTINGUISHING MEDIA

- Water spray or fog.
- Foam.
- Dry chemical powder.
- BCF (where regulations permit).
- Carbon dioxide.

continued...

# O-CRESOLPHTHALEIN COMPLEXONE

GHS Safety Data Sheet

Version No:2.0

Page 3 of 8

## Section 5 - FIRE FIGHTING MEASURES

### FIRE/EXPLOSION HAZARD

- Combustible.
- Slight fire hazard when exposed to heat or flame.
- Heating may cause expansion or decomposition leading to violent rupture of containers.
- On combustion, may emit toxic fumes of carbon monoxide (CO).
- May emit acrid smoke. May emit corrosive fumes.

## Section 6 - ACCIDENTAL RELEASE MEASURES

### EMERGENCY PROCEDURES

#### MINOR SPILLS

- Clean up all spills immediately.
- Avoid contact with skin and eyes.
- Wear impervious gloves and safety glasses.
- Use dry clean up procedures and avoid generating dust.
- Sweep up or
- Vacuum up (consider explosion-proof machines designed to be grounded during storage and use).
- Place spilled material in clean, dry, sealable, labelled container.

#### MAJOR SPILLS

Minor hazard.

- Clear area of personnel.
- Alert Fire Brigade and tell them location and nature of hazard.
- Control personal contact by using protective equipment if risk of overexposure exists.
- Prevent, by any means available, spillage from entering drains or water courses.
- Contain spill/secure load if safe to do so.
- Bundle/collect recoverable product and label for recycling.
- Collect remaining product and place in appropriate containers for disposal.
- Clean up/sweep up area. Water may be required.
- If contamination of drains or waterways occurs, advise emergency services.

### SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS



+ + + + + +

+: May be stored together

O: May be stored together with specific precautions

X: Must not be stored together

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

## Section 7 - HANDLING AND STORAGE

### PROCEDURE FOR HANDLING

- Avoid generating and breathing dust

continued...

# O-CRESOLPHTHALEIN COMPLEXONE

GHS Safety Data Sheet

Version No:2.0

Page 4 of 8

## Section 7 - HANDLING AND STORAGE

---

- Avoid contact with skin and eyes.
- Wear nominated personal protective equipment when handling.
- Use in a well-ventilated area.
- Use good occupational work practices.
- Observe manufacturer's storing and handling recommendations.

### SUITABLE CONTAINER

- Check that containers are clearly labelled.
- Packaging as recommended by manufacturer.

### STORAGE INCOMPATIBILITY

Avoid storage with strong oxidizers.

### STORAGE REQUIREMENTS

- Keep dry.
- Store under cover.
- Protect containers against physical damage.
- Observe manufacturer's storing and handling recommendations.

---

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

---

### EXPOSURE CONTROLS

The following materials had no OELs on our records

- o- cresolphthalein complexone: CAS:2411- 89- 4

### MATERIAL DATA

These "dusts" have little adverse effect on the lungs and do not produce toxic effects or organic disease. Although there is no dust which does not evoke some cellular response at sufficiently high concentrations, the cellular response caused by P.N.O.C.s has the following characteristics:

- the architecture of the air spaces remain intact,
- scar tissue (collagen) is not synthesised to any degree,
- tissue reaction is potentially reversible.

Extensive concentrations of P.N.O.C.s may:

- seriously reduce visibility,
- cause unpleasant deposits in the eyes, ears and nasal passages,
- contribute to skin or mucous membrane injury by chemical or mechanical action, per se, or by the rigorous skin cleansing procedures necessary for their removal. [ACGIH]

This limit does not apply:

- to brief exposures to higher concentrations
- nor does it apply to those substances that may cause physiological impairment at lower concentrations but for which a TLV has as yet to be determined.

This exposure standard applies to particles which

- are insoluble or poorly soluble\* in water or, preferably, in aqueous lung fluid (if data is available) and

• have a low toxicity (i.e.. are not cytotoxic, genotoxic, or otherwise chemically reactive with lung tissue, and do not emit ionizing radiation, cause immune sensitization, or cause toxic effects other than by inflammation or by a mechanism of lung overload).

continued...

# O-CRESOLPHTHALEIN COMPLEXONE

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

### PERSONAL PROTECTION



#### EYE

No special equipment for minor exposure i.e. when handling small quantities.

· OTHERWISE:

- Safety glasses with side shields.
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59].

#### HANDS/FEET

Wear general protective gloves, eg. light weight rubber gloves.

#### OTHER

No special equipment needed when handling small quantities.

OTHERWISE:

- Overalls.
- Barrier cream.
- Eyewash unit.

#### RESPIRATOR

| Protection Factor | Half- Face Respirator | Full- Face Respirator | Powered Air Respirator |
|-------------------|-----------------------|-----------------------|------------------------|
| 10 x ES           | P1 Air- line*         | - -                   | PAPR- P1 -             |
| 50 x ES           | Air- line**           | P2                    | PAPR- P2               |
| 100 x ES          | -                     | P3                    | -                      |
|                   |                       | Air- line*            | -                      |
| 100+ x ES         | -                     | Air- line**           | PAPR- P3               |

\* - Negative pressure demand \*\* - Continuous flow.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required.

For further information consult your Occupational Health and Safety Advisor.

### ENGINEERING CONTROLS

General exhaust is adequate under normal operating conditions. If risk of overexposure exists, wear SAA approved respirator. Correct fit is essential to obtain adequate protection. Provide adequate ventilation in warehouse or closed storage areas. Air

continued...

# O-CRESOLPHTHALEIN COMPLEXONE

GHS Safety Data Sheet

Version No:2.0

Page 6 of 8

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

|                                                                                                                                                                                                                     |                                |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------|
| Type of Contaminant:                                                                                                                                                                                                | Air Speed:                     |
| solvent, vapours, degreasing etc., evaporating from tank (in still air)                                                                                                                                             | 0.25- 0.5 m/s (50- 100 f/min)  |
| aerosols, fumes from pouring operations, intermittent container filling, low speed conveyer transfers, welding, spray drift, plating acid fumes, pickling (released at low velocity into zone of active generation) | 0.5- 1 m/s (100- 200 f/min.)   |
| direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion)                                                      | 1- 2.5 m/s (200- 500 f/min)    |
| grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion).                                                                | 2.5- 10 m/s (500- 2000 f/min.) |

Within each range the appropriate value depends on:

|                                                           |                                    |
|-----------------------------------------------------------|------------------------------------|
| Lower end of the range                                    | Upper end of the range             |
| 1: Room air currents minimal or favourable to capture     | 1: Disturbing room air currents    |
| 2: Contaminants of low toxicity or of nuisance value only | 2: Contaminants of high toxicity   |
| 3: Intermittent, low production.                          | 3: High production, heavy use      |
| 4: Large hood or large air mass in motion                 | 4: Small hood - local control only |

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 1-2 m/s (200-400 f/min.) for extraction of solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

## Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

### APPEARANCE

White powder. No odour.  
Precomplexed indicator normally used in low concentrations and small amounts.

### PHYSICAL PROPERTIES

Solid.  
Mixes with water.

Molecular Weight: 636.61  
Melting Range (°C): Not available.

Boiling Range (°C): Not applicable.  
Specific Gravity (water=1): Not available.

continued...

# O-CRESOLPHTHALEIN COMPLEXONE

GHS Safety Data Sheet

Version No:2.0

Page 7 of 8

## Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

Solubility in water (g/L): Miscible  
pH (1% solution): Not available.  
Volatile Component (%vol): Negligible  
Relative Vapour Density (air=1): Not applicable  
Lower Explosive Limit (%): Not available.  
Autoignition Temp (°C): Not available.  
State: Divided solid

pH (as supplied): Not applicable  
Vapour Pressure (kPa): Negligible  
Evaporation Rate: Not applicable  
Flash Point (°C): Not applicable  
Upper Explosive Limit (%): Not available.  
Decomposition Temp (°C): Not available.

## Section 10 - CHEMICAL STABILITY AND REACTIVITY INFORMATION

### CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

## Section 11 - TOXICOLOGICAL INFORMATION

### POTENTIAL HEALTH EFFECTS

#### ACUTE HEALTH EFFECTS

##### SWALLOWED

Although ingestion is not thought to produce harmful effects (as classified under EC Directives), the material may still be damaging to the health of the individual, following ingestion, especially where pre-existing organ (e.g liver, kidney) damage is evident. Present definitions of harmful or toxic substances are generally based on doses producing mortality rather than those producing morbidity (disease, ill-health). Gastrointestinal tract discomfort may produce nausea and vomiting. In an occupational setting however, ingestion of insignificant quantities is not thought to be cause for concern.

Considered an unlikely route of entry in commercial/industrial environments.

##### EYE

Although the material is not thought to be an irritant (as classified by EC Directives), direct contact with the eye may produce transient discomfort characterised by tearing or conjunctival redness (as with windburn).

##### SKIN

The material is not thought to produce adverse health effects or skin irritation following contact (as classified by EC Directives using animal models). Nevertheless, good hygiene practice requires that exposure be kept to a minimum and that suitable gloves be used in an occupational setting.

##### INHALED

The material is not thought to produce adverse health effects or irritation of the respiratory tract (as classified by EC Directives using animal models). Nevertheless, good hygiene practice requires that exposure be kept to a minimum and that suitable control measures be used in an occupational setting.

continued...

# O-CRESOLPHTHALEIN COMPLEXONE

GHS Safety Data Sheet

Version No:2.0

Page 8 of 8

## Section 11 - TOXICOLOGICAL INFORMATION

---

### CHRONIC HEALTH EFFECTS

Principal route of exposure is by eye/skin contact with solid.

Usually kept as dilute solutions.

As with any chemical, ingestion, inhalation and prolonged or repeated skin contact should be avoided by good occupational work practice.

### TOXICITY AND IRRITATION

None available.

unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances

---

## Section 12 - ECOLOGICAL INFORMATION

---

No data for o-cresolphthalein complexone.

---

## Section 13 - DISPOSAL CONSIDERATIONS

---

- Recycle wherever possible or consult manufacturer for recycling options.
- Consult State Land Waste Management Authority for disposal.
- Bury residue in an authorised landfill.
- Recycle containers if possible, or dispose of in an authorised landfill.

---

## Section 14 - TRANSPORTATION INFORMATION

---

HAZCHEM: None

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS:UN, IATA,  
IMDG

---

## Section 15 - REGULATORY INFORMATION

---

### REGULATIONS

No regulations applicable

No data available for o-cresolphthalein complexone as CAS: 2411-89-4.

---

## Section 16 - OTHER INFORMATION

---

The above information is believed to be accurate and represent the best information currently available to us, but does not represent any warranty expressed or implied of the properties of the product. User should make their own investigation to determine the suitability of the information for their particular purpose.

Issue Date: 5-Apr-2018