

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 1 of 15

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME

HEPTANE

OTHER NAMES

C7-H16, CH₃(CH₂)₅CH₃, "heptane isomers fractions solvent", "dipropyl methane", "heptyl hydride", Gettysolve-C

PROPER SHIPPING NAME

HEPTANES

PRODUCT USE

The use of a quantity of material in an unventilated or confined space may result in increased exposure and an irritating atmosphere developing.

Before starting consider control of exposure by mechanical ventilation.

Used as solvent, in lacquer and enamels; as a component of aliphatic solvent blends.

Used in organic synthesis. Archaic use as an anaesthetic.

SUPPLIER

Company: S D FINE- CHEM LIMITED

Address:

315- 317, T.V. INDUSTRIAL ESTATE,

248, WORLI,

MUMBAI- 400030.INDIA.


technical@sdfine.com

Telephone: 91- 22- 24959898

Telephone: 91- 22- 24959899

Fax: 91- 22- 24937232

HAZARD RATINGS

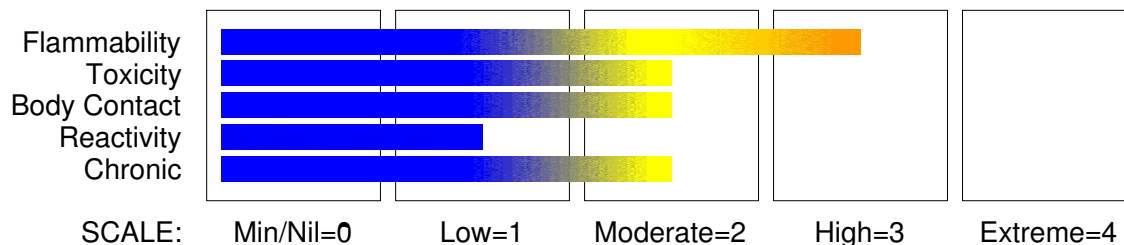

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 2 of 15

Section 2 - HAZARDS IDENTIFICATION

GHS Classification

Chronic Aquatic Hazard Category 1

Eye Irritation Category 2B

Flammable Liquid Category 2

Respiratory Irritation Category 3

Skin Corrosion/Irritation Category 2



EMERGENCY OVERVIEW

HAZARD

DANGER

Determined by using GHS criteria:

H335 H225 H315 H320 H410

May cause respiratory irritation

Highly flammable liquid and vapour

Causes skin irritation

Causes eye irritation

Very toxic to aquatic life with long lasting effects

PRECAUTIONARY STATEMENTS

Prevention

Use only non-sparking tools.

Take precautionary measures against static discharge

Ground/bond container and receiving equipment.

Wash thoroughly after handling.

Wash hands thoroughly after handling.

Use explosion-proof electrical/ventilating/lighting/equipment

Keep away from heat/sparks/open flame - No smoking.

Keep container tightly closed.

Wear protective gloves and eye/face protection.

Response

If eye irritation persists, get medical advice/attention.

IF ON SKIN: Gently wash with plenty of soap and water.

IF SWALLOWED: Rinse mouth. Do NOT induce vomiting.

IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.

If skin irritation occurs, seek medical advice/attention.

In case of fire, use foam for extinction.

If on skin or hair: remove/take off immediately all contaminated clothing. Rinse with

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 3 of 15

Section 2 - HAZARDS IDENTIFICATION

water/shower.
Wash/Decontaminate removed clothing before reuse.
Remove/Take off immediately all contaminated clothing

Disposal

Dispose of contents and container in accordance with relevant legislation.

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
heptane	142-82-5	>99
consisting of		
n- heptane, and its isomers		

Section 4 - FIRST AID MEASURES

SWALLOWED

If spontaneous vomiting appears imminent or occurs, hold patient's head down, lower than their hips to help avoid possible aspiration of vomitus.

- If swallowed do NOT induce vomiting.
 - If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.
 - Observe the patient carefully.
 - Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.
 - Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.
 - Seek medical advice.
- Avoid giving milk or oils.
Avoid giving alcohol.

EYE

If this product comes in contact with the eyes:

- Wash out immediately with fresh running water.
- Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
- If pain persists or recurs seek medical attention.
- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

If skin contact occurs:

- Immediately remove all contaminated clothing, including footwear.
- Flush skin and hair with running water (and soap if available).
- Seek medical attention in event of irritation.

INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 4 of 15

Section 4 - FIRST AID MEASURES

- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor.

NOTES TO PHYSICIAN

Any material aspirated during vomiting may produce lung injury. Therefore emesis should not be induced mechanically or pharmacologically. Mechanical means should be used if it is considered necessary to evacuate the stomach contents; these include gastric lavage after endotracheal intubation. If spontaneous vomiting has occurred after ingestion, the patient should be monitored for difficult breathing, as adverse effects of aspiration into the lungs may be delayed up to 48 hours.

For acute or short term repeated exposures to petroleum distillates or related hydrocarbons:

- Primary threat to life, from pure petroleum distillate ingestion and/or inhalation, is respiratory failure.
- Patients should be quickly evaluated for signs of respiratory distress (e.g. cyanosis, tachypnoea, intercostal retraction, obtundation) and given oxygen. Patients with inadequate tidal volumes or poor arterial blood gases (pO₂ 50 mm Hg) should be intubated.
- Arrhythmias complicate some hydrocarbon ingestion and/or inhalation and electrocardiographic evidence of myocardial injury has been reported; intravenous lines and cardiac monitors should be established in obviously symptomatic patients. The lungs excrete inhaled solvents, so that hyperventilation improves clearance.
- A chest x-ray should be taken immediately after stabilisation of breathing and circulation to document aspiration and detect the presence of pneumothorax.
- Epinephrine (adrenalin) is not recommended for treatment of bronchospasm because of potential myocardial sensitisation to catecholamines. Inhaled cardioselective bronchodilators (e.g. Alupent, Salbutamol) are the preferred agents, with aminophylline a second choice.
- Lavage is indicated in patients who require decontamination; ensure use of cuffed endotracheal tube in adult patients. [Ellenhorn and Barceloux: Medical Toxicology].

Section 5 - FIRE FIGHTING MEASURES

EXTINGUISHING MEDIA

- Foam.
- Dry chemical powder.
- BCF (where regulations permit).
- Carbon dioxide.
- Water spray or fog - Large fires only.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- May be violently or explosively reactive.
- Wear breathing apparatus plus protective gloves.
- Prevent, by any means available, spillage from entering drains or water course.
- Consider evacuation (or protect in place).
- Fight fire from a safe distance, with adequate cover.
- If safe, switch off electrical equipment until vapour fire hazard removed.
- Use water delivered as a fine spray to control the fire and cool adjacent area.
- Avoid spraying water onto liquid pools.
- Do not approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 5 of 15

Section 5 - FIRE FIGHTING MEASURES

- If safe to do so, remove containers from path of fire.

FIRE/EXPLOSION HAZARD

- Liquid and vapour are highly flammable.
- Severe fire hazard when exposed to heat, flame and/or oxidisers.
- Vapour may travel a considerable distance to source of ignition.
- Heating may cause expansion or decomposition leading to violent rupture of containers.
- On combustion, may emit toxic fumes of carbon monoxide (CO).

Combustion products include: carbon dioxide (CO₂), other pyrolysis products typical of burning organic material.

Contains low boiling substance: Closed containers may rupture due to pressure buildup under fire conditions.

May emit clouds of acrid smoke.

FIRE INCOMPATIBILITY

Avoid contamination with oxidising agents i.e. nitrates, oxidising acids, chlorine bleaches, pool chlorine etc. as ignition may result.

Personal Protective Equipment

Breathing apparatus.
Chemical splash suit.

Section 6 - ACCIDENTAL RELEASE MEASURES

EMERGENCY PROCEDURES

MINOR SPILLS

- Remove all ignition sources.
- Clean up all spills immediately.
- Avoid breathing vapours and contact with skin and eyes.
- Control personal contact by using protective equipment.
- Contain and absorb small quantities with vermiculite or other absorbent material.
- Wipe up.
- Collect residues in a flammable waste container.

MAJOR SPILLS

- Clear area of personnel and move upwind.
- Alert Fire Brigade and tell them location and nature of hazard.
- May be violently or explosively reactive.
- Wear breathing apparatus plus protective gloves.
- Prevent, by any means available, spillage from entering drains or water course.
- Consider evacuation (or protect in place).
- No smoking, naked lights or ignition sources.
- Increase ventilation.
- Stop leak if safe to do so.
- Water spray or fog may be used to disperse /absorb vapour.
- Contain spill with sand, earth or vermiculite.
- Use only spark-free shovels and explosion proof equipment.
- Collect recoverable product into labelled containers for recycling.
- Absorb remaining product with sand, earth or vermiculite.
- Collect solid residues and seal in labelled drums for disposal.
- Wash area and prevent runoff into drains.
- If contamination of drains or waterways occurs, advise emergency services.

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 6 of 15

Section 6 - ACCIDENTAL RELEASE MEASURES

EMERGENCY RESPONSE PLANNING GUIDELINES (ERPG)

The maximum airborne concentration below which it is believed that nearly all individuals could be exposed for up to one hour WITHOUT experiencing or developing

life-threatening health effects is:

heptane 750 ppm

irreversible or other serious effects or symptoms which could impair an individual's ability to take

protective action is:

heptane 440 ppm

other than mild, transient adverse effects without perceiving a clearly defined odour is:

heptane 440 ppm

The threshold concentration below which most people will experience no appreciable risk of health effects:

heptane 440 ppm

American Industrial Hygiene Association (AIHA)

Ingredients considered according to the following cutoffs

Very Toxic (T+)	$\geq 0.1\%$	Toxic (T)	$\geq 3.0\%$
R50	$\geq 0.25\%$	Corrosive (C)	$\geq 5.0\%$
R51	$\geq 2.5\%$		
else	$\geq 10\%$		

where percentage is percentage of ingredient found in the mixture

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS



+: May be stored together

O: May be stored together with specific precautions

X: Must not be stored together

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

Section 7 - HANDLING AND STORAGE

PROCEDURE FOR HANDLING

- Containers, even those that have been emptied, may contain explosive vapours.
- Do NOT cut, drill, grind, weld or perform similar operations on or near containers.
- Electrostatic discharge may be generated during pumping - this may result in fire.
- Ensure electrical continuity by bonding and grounding (earthing) all equipment.
- Restrict line velocity during pumping in order to avoid generation of electrostatic discharge (≤ 1 m/sec until fill pipe submerged to twice its diameter, then ≤ 7 m/sec).
- Avoid splash filling.
- Do NOT use compressed air for filling discharging or handling operations.
- Avoid all personal contact, including inhalation.

continued...

HEPTANE

Section 7 - HANDLING AND STORAGE

- Wear protective clothing when risk of exposure occurs.
 - Use in a well-ventilated area.
 - Prevent concentration in hollows and sumps.
 - DO NOT enter confined spaces until atmosphere has been checked.
 - Avoid smoking, naked lights, heat or ignition sources.
 - When handling, DO NOT eat, drink or smoke.
 - Vapour may ignite on pumping or pouring due to static electricity.
 - DO NOT use plastic buckets.
 - Earth and secure metal containers when dispensing or pouring product.
 - Use spark-free tools when handling.
 - Avoid contact with incompatible materials.
 - Keep containers securely sealed.
 - Avoid physical damage to containers.
 - Always wash hands with soap and water after handling.
 - Work clothes should be laundered separately.
 - Use good occupational work practice.
 - Observe manufacturer's storing and handling recommendations.
 - Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions.
- DO NOT allow clothing wet with material to stay in contact with skin.

SUITABLE CONTAINER

- Packing as supplied by manufacturer.
- Plastic containers may only be used if approved for flammable liquid.
- Check that containers are clearly labelled and free from leaks.
- For low viscosity materials (i) : Drums and jerry cans must be of the non-removable head type. (ii) : Where a can is to be used as an inner package, the can must have a screwed enclosure.
- For materials with a viscosity of at least 2680 cSt. (23 deg. C)
- For manufactured product having a viscosity of at least 250 cSt. (23 deg. C)
- Manufactured product that requires stirring before use and having a viscosity of at least 20 cSt (25 deg. C)
- (i) : Removable head packaging;
- (ii) : Cans with friction closures and
- (iii) : low pressure tubes and cartridges may be used.
- Where combination packages are used, and the inner packages are of glass, there must be sufficient inert cushioning material in contact with inner and outer packages
- In addition, where inner packagings are glass and contain liquids of packing group I there must be sufficient inert absorbent to absorb any spillage, unless the outer packaging is a close fitting moulded plastic box and the substances are not incompatible with the plastic.

STORAGE INCOMPATIBILITY

Avoid reaction with oxidising agents.

STORAGE REQUIREMENTS

- Store in original containers in approved flame-proof area.
- No smoking, naked lights, heat or ignition sources.
- DO NOT store in pits, depressions, basements or areas where vapours may be trapped.
- Keep containers securely sealed.
- Store away from incompatible materials in a cool, dry well ventilated area.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations.

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 8 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

EXPOSURE CONTROLS

The following materials had no OELs on our records

- heptane:

CAS:116502- 45- 5 CAS:3474- 30- 4 CAS:3356- 67-
0 CAS:78918- 91- 9 CAS:142- 82- 5

EMERGENCY EXPOSURE LIMITS

Material	Revised IDLH Value (mg/m3)	Revised IDLH Value (ppm)
heptane		750

ODOUR SAFETY FACTOR (OSF)

OSF=2.7 (n-HEPTANE)

Exposed individuals are NOT reasonably expected to be warned, by smell, that the Exposure Standard is being exceeded.

Odour Safety Factor (OSF) is determined to fall into either Class C, D or E.

The Odour Safety Factor (OSF) is defined as:

OSF= Exposure Standard (TWA) ppm/ Odour Threshold Value (OTV) ppm

Classification into classes follows:

Class	OSF	Description
A	550	Over 90% of exposed individuals are aware by smell that the Exposure Standard (TLV- TWA for example) is being reached, even when distracted by working activities
B	26- 550	As " A" for 50- 90% of persons being distracted
C	1- 26	As " A" for less than 50% of persons being distracted
D	0.18- 1	10- 50% of persons aware of being tested perceive by smell that the Exposure Standard is being reached
E	<0.18	As " D" for less than 10% of persons aware of being tested

MATERIAL DATA

The TLV-TWA is protective against narcotic and irritant effects which are greater than those of pentane or n-hexane but less than those of octane.

The TLV-TWA applies to all isomers.

Inhalation by humans of 1000 ppm for 6 minutes produced slight dizziness.

Higher concentrations for shorter periods produce marked vertigo, incoordination and hilarity. Signs of central nervous system depression occur in the absence of mucous membrane irritation. Brief exposures to high levels (5000 ppm for 4 minutes) produce nausea, loss of appetite and a "gasoline-like" taste in the mouth that persists for many hours after exposure ceases.

continued...

HEPTANE

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

PERSONAL PROTECTION



EYE

- Safety glasses with side shields.
- Chemical goggles.
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59].

HANDS/FEET

Suitability and durability of glove type is dependent on usage. Factors such as:

- frequency and duration of contact,
- chemical resistance of glove material,
- glove thickness and
- dexterity,

are important in the selection of gloves.

Neoprene rubber gloves.

Wear chemical protective gloves, eg. PVC.

Wear safety footwear or safety gumboots, eg. Rubber.

OTHER

- Overalls.
- PVC Apron.
- PVC protective suit may be required if exposure severe.
- Eyewash unit.
- Ensure there is ready access to a safety shower.

GLOVE SELECTION INDEX

Glove selection is based on a modified presentation of the:

"Forsberg Clothing Performance Index".

The effect(s) of the following substance(s) are taken into account in the computer-generated selection: heptane

NITRILE+PVC
NITRILE
HYPALON

A
B
B

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 10 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

PVC	C
NEOPRENE	C
NATURAL RUBBER	C

A: Best Selection

B: Satisfactory; may degrade after 4 hours continuous immersion

C: Poor to Dangerous Choice for other than short term immersion

NOTE: As a series of factors will influence the actual performance of the glove, a final selection must be based on detailed observation. -

* Where the glove is to be used on a short term, casual or infrequent basis, factors such as "feel" or convenience (e.g. disposability), may dictate a choice of gloves which might otherwise be unsuitable following long-term or frequent use. A qualified practitioner should be consulted.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required.

For further information consult your Occupational Health and Safety Advisor.

ENGINEERING CONTROLS

CARE: Use of a quantity of this material in confined space or poorly ventilated area, where rapid build up of concentrated atmosphere may occur, could require increased ventilation and/or protective gear.

For flammable liquids and flammable gases, local exhaust ventilation or a process enclosure ventilation system may be required. Ventilation equipment should be explosion-resistant.

Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

Type of Contaminant:

solvent, vapours, degreasing etc., evaporating from tank (in still air).

aerosols, fumes from pouring operations,

intermittent container filling, low speed

conveyer transfers, welding, spray drift,

plating acid fumes, pickling (released at low velocity into zone of active generation)

direct spray, spray painting in shallow booths,

drum filling, conveyer loading, crusher dusts,

gas discharge (active generation into zone of rapid air motion)

Air Speed:

0.25- 0.5 m/s (50- 100 f/min.)

0.5- 1 m/s (100- 200 f/min.)

1- 2.5 m/s (200- 500 f/min.)

Within each range the appropriate value depends on:

Lower end of the range

1: Room air currents minimal or favourable to capture

2: Contaminants of low toxicity or of nuisance value only.

3: Intermittent, low production.

4: Large hood or large air mass in motion

Upper end of the range

1: Disturbing room air currents

2: Contaminants of high toxicity

3: High production, heavy use

4: Small hood- local control only

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 11 of 15

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 1-2 m/s (200-400 f/min.) for extraction of solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

APPEARANCE

Clear colourless flammable liquid; floats on water. Mild petrol-like odour.
Mixes with hydrocarbons and other non-polar solvents, soluble in alcohol.

PHYSICAL PROPERTIES

Liquid.
Does not mix with water.
Floats on water.

Molecular Weight: 100.2
Melting Range (°C): - 91
Solubility in water (g/L): Immiscible
pH (1% solution): Not applicable.
Volatile Component (%vol): 100
Relative Vapour Density (air=1): 3.5
Lower Explosive Limit (%): 1.1
Autoignition Temp (°C): 215
State: Liquid

Boiling Range (°C): 98.4
Specific Gravity (water=1): 0.7
pH (as supplied): Not applicable
Vapour Pressure (kPa): 6.36 @ 25 C
Evaporation Rate: Not available
Flash Point (°C): - 3.9
Upper Explosive Limit (%): 6.7
Decomposition Temp (°C): Not Available
Viscosity: Not Available

log Kow (Sangster 1997): 4.66
log Kow: 4.66

Section 10 - CHEMICAL STABILITY AND REACTIVITY INFORMATION

CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

Section 11 - TOXICOLOGICAL INFORMATION

POTENTIAL HEALTH EFFECTS

ACUTE HEALTH EFFECTS

continued...

HEPTANE

Section 11 - TOXICOLOGICAL INFORMATION

SWALLOWED

Accidental ingestion of the material may be damaging to the health of the individual. Swallowing of the liquid may cause aspiration into the lungs with the risk of chemical pneumonitis; serious consequences may result. (ICSC13733).

Considered an unlikely route of entry in commercial/industrial environments. The liquid may produce gastrointestinal discomfort and may be harmful if swallowed. Ingestion may result in nausea, pain and vomiting. Vomit entering the lungs by aspiration may cause potentially lethal chemical pneumonitis.

EYE

Limited evidence exists, or practical experience suggests, that the material may cause eye irritation in a substantial number of individuals and/or is expected to produce significant ocular lesions which are present twenty-four hours or more after instillation into the eye(s) of experimental animals. Repeated or prolonged eye contact may cause inflammation characterised by temporary redness (similar to windburn) of the conjunctiva (conjunctivitis); temporary impairment of vision and/or other transient eye damage/ulceration may occur.

SKIN

Skin contact with the material may damage the health of the individual; systemic effects may result following absorption.

Evidence exists, or practical experience predicts, that the material either produces inflammation of the skin in a substantial number of individuals following direct contact, and/or produces significant inflammation when applied to the healthy intact skin of animals, for up to four hours, such inflammation being present twenty-four hours or more after the end of the exposure period. Skin irritation may also be present after prolonged or repeated exposure; this may result in a form of contact dermatitis (nonallergic). The dermatitis is often characterised by skin redness (erythema) and swelling (oedema) which may progress to blistering (vesiculation), scaling and thickening of the epidermis. At the microscopic level there may be intercellular oedema of the spongy layer of the skin (spongiosis) and intracellular oedema of the epidermis.

The material may accentuate any pre-existing dermatitis condition.

Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects. Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.

INHALED

Inhalation may produce health damage*.

Inhalation of vapours or aerosols (mists, fumes), generated by the material during the course of normal handling, may be damaging to the health of the individual.

Limited evidence or practical experience suggests that the material may produce irritation of the respiratory system, in a significant number of individuals, following inhalation. In contrast to most organs, the lung is able to respond to a chemical insult by first removing or neutralising the irritant and then repairing the damage. The repair process, which initially evolved to protect mammalian lungs from foreign matter and antigens, may however, produce further lung damage resulting in the impairment of gas exchange, the primary function of the lungs. Respiratory tract irritation often results in an inflammatory response involving the recruitment and activation of many cell types, mainly derived from the vascular system.

Inhalation hazard is increased at higher temperatures.

Inhalation of vapours may cause drowsiness and dizziness. This may be accompanied by narcosis, reduced alertness, loss of reflexes, lack of coordination and vertigo.

Acute effects from inhalation of high concentrations of vapour are pulmonary irritation, including coughing, with nausea; central nervous system depression - characterised by

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 13 of 15

Section 11 - TOXICOLOGICAL INFORMATION

headache and dizziness, increased reaction time, fatigue and loss of co-ordination. Central nervous system (CNS) depression may include nonspecific discomfort, symptoms of giddiness, headache, dizziness, nausea, anaesthetic effects, slowed reaction time, slurred speech and may progress to unconsciousness. Serious poisonings may result in respiratory depression and may be fatal.

If exposure to highly concentrated solvent atmosphere is prolonged this may lead to narcosis, unconsciousness, even coma and possible death.

The use of a quantity of material in an unventilated or confined space may result in increased exposure and an irritating atmosphere developing.

Before starting consider control of exposure by mechanical ventilation.

CHRONIC HEALTH EFFECTS

Limited evidence suggests that repeated or long-term occupational exposure may produce cumulative health effects involving organs or biochemical systems.

Chronic solvent inhalation exposures may result in nervous system impairment and liver and blood changes. [PATTYS].

TOXICITY AND IRRITATION

TOXICITY

Inhalation (human) TCl₀: 1000 ppm/6m

IRRITATION

Nil Reported

Section 12 - ECOLOGICAL INFORMATION

Fish LC ₅₀ (96hr.) (mg/l):	4924
log Kow (Sangster 1997):	4.66
BOD ₅ :	1.92
COD:	0.06

The lower molecular weight hydrocarbons are expected to form a "slick" on the surface of waters after release in calm sea conditions. This is expected to evaporate and enter the atmosphere where it will be degraded through reaction with hydroxy radicals.

Some of the material will become associated with benthic sediments, and it is likely to be spread over a fairly wide area of sea floor. Marine sediments may be either aerobic or anaerobic. The material, in probability, is biodegradable, under aerobic conditions (isomerised olefins and alkenes show variable results). Evidence also suggests that the hydrocarbons may be degradable under anaerobic conditions although such degradation in benthic sediments may be a relatively slow process.

Under aerobic conditions the material will degrade to water and carbon dioxide, while under anaerobic processes it will produce water, methane and carbon dioxide.

Based on test results, as well as theoretical considerations, the potential for bioaccumulation may be high. Toxic effects are often observed in species such as blue mussel, daphnia, freshwater green algae, marine copepods and amphipods.

Drinking Water Standards:

hydrocarbon total: 10 ug/l (UK max.).

Do NOT allow product to come in contact with surface waters or to intertidal areas below the mean high water mark. Do not contaminate water when cleaning equipment or disposing of equipment wash-waters.

Wastes resulting from use of the product must be disposed of on site or at approved waste sites.

DO NOT discharge into sewer or waterways.

log Kow: 4.66

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 14 of 15

Section 12 - ECOLOGICAL INFORMATION

Koc: 2400-8100
Half-life (hr) air: 52.8
Half-life (hr) H₂O surface water: 2.9-312
Henry's atm m³ /mol: 2.06
BOD 5 if unstated: 1.92
COD: 0.06
BCF: 340-2000
Log BCF: 2.53-3.31

Section 13 - DISPOSAL CONSIDERATIONS

- Recycle wherever possible.
- Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.
- Dispose of by: Burial in a licenced land-fill or Incineration in a licenced apparatus (after admixture with suitable combustible material).
- Decontaminate empty containers. Observe all label safeguards until containers are cleaned and destroyed.

WASTE DISPOSAL PROCEDURES

- Package and label the recoverable quantities of heptane for incineration or distill and reuse the recoverable quantities. Place small quantities of heptane into an evaporating dish or beaker and allow to evaporate in a well ventilated area. Ensure that no

SPILLAGE DISPOSAL

- Shut off all ignition sources. Clear area of personnel. Wear a self-contained breathing apparatus, nitrile rubber gloves and protective clothing. Cover and contain the heptane spill with a 1:1:1 mixture by weight of soda ash, bentonite and sand. Scoop t

Section 14 - TRANSPORTATION INFORMATION



Labels Required: FLAMMABLE LIQUID
HAZCHEM: 3[Y]E

UNDG:

Dangerous Goods Class: 3
UN Number: 1206
Shipping Name: HEPTANES

Subrisk: None
Packing Group: II

continued...

HEPTANE

GHS Safety Data Sheet

Version No:4

Page 15 of 15

Section 14 - TRANSPORTATION INFORMATION

Air Transport IATA:

ICAO/IATA Class:	3	ICAO/IATA Subrisk:	None
UN/ID Number:	1206	Packing Group:	II
ERG Code:	3H		
Shipping name:HEPTANES			

Maritime Transport IMDG:

IMDG Class:	3	IMDG Subrisk:	None
UN Number:	1206	Packing Group:	II
EMS Number:	F- E, S- D		
Shipping name:HEPTANES			

Section 15 - REGULATORY INFORMATION

REGULATIONS

heptane (CAS: 142-82-5) is found on the following regulatory lists;
IMO MARPOL 73/78 (Annex II) - List of Other Liquid Substances
International Council of Chemical Associations (ICCA) - High Production Volume List
OECD Representative List of High Production Volume (HPV) Chemicals

No data available for heptane as CAS: 116502-45-5, CAS: 3474-30-4, CAS: 3356-67-0, CAS: 78918-91-9.

Section 16 - OTHER INFORMATION

INGREDIENTS WITH MULTIPLE CAS NUMBERS

Ingredient Name	CAS
heptane	116502- 45- 5, 3474- 30- 4, 3356- 67- 0, 78918- 91- 9, 142- 82- 5

The above information is believed to be accurate and represent the best information currently available to us, but does not represent any warranty expressed or implied of the properties of the product. User should make their own investigation to determine the suitability of the information for their particular purpose.

Issue Date: 8-Jul-2018